Super Axonometric

It is a quintessential function that can easily convert a plan drawing to an axonometric drawing.
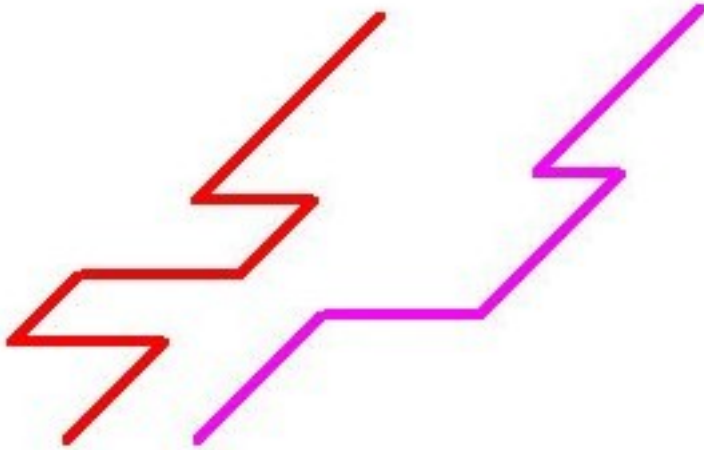
Menu : Express > GstarCAD Tools > Super Axonometric
Command Entry : ZC

Operation steps:

1.Start the command.

2.Select objects and press enter, as shown below.
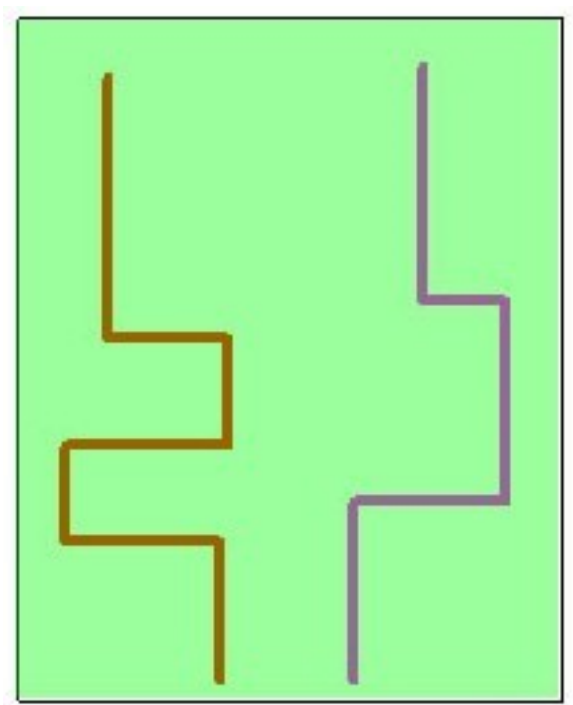
3.Enter the axonometric point of view, such as 45 degree.

4.The effect will be as below.

Online URL: https://www.kb2.gstarcad.com.my/article.php?id=1060